
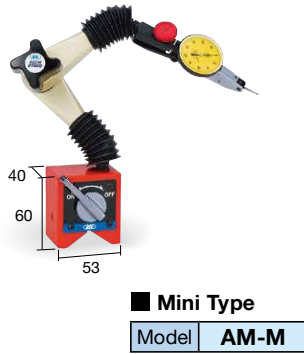
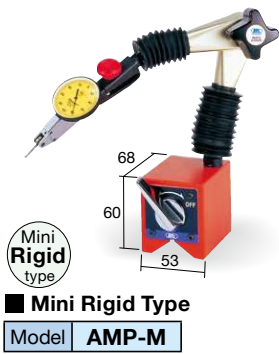




Flexible arm stand which locks solidly by the special cam mechanism.

Magnetic Base Type

- Firmly fixed with a powerful magnet.

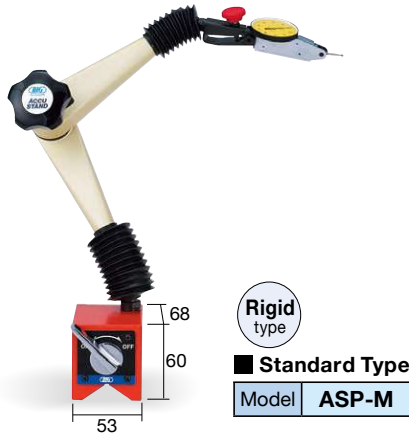


Compact yet tough arm and powerful clamp.
 Mini-Mini Type!

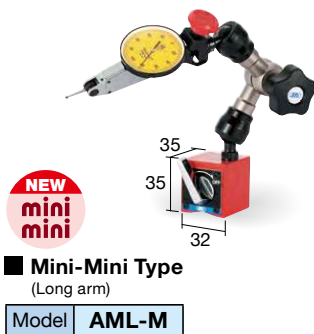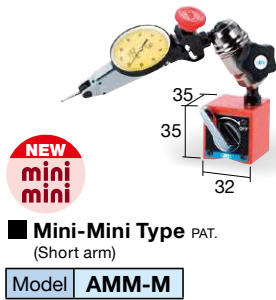


※ Test indicators and dial gauges are not included with any model.

The thread size of the joint between the magnet and arm is M8 x P1.25 for AMM, AML and AM and M10 x P1.5 for AMP and ASP.


● AMM-M




● AML-M




● AM-M



● AMP-M



● ASP-M



Gauge support details I19

ACCU STAND

Cast Base Type

- Cast base type ideal for precision measurement on a surface plate




Rigid type

Model **ASP-B**

The base shape is designed for stability, with a precision-ground bottom surface that enables higher-precision measurement. The side is also ground perpendicular to the bottom, allowing measurement while sliding.

● ASP-B

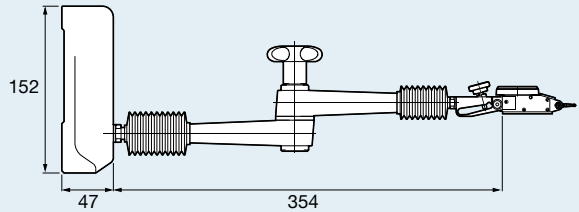

The thread size of the joint between the cast base and arm is M10 x P1.5.


See below for gauge support details

Gauge support details (Test indicators and dial gauges are not included.)

Standard/Mini Type

Fine adjustment knob [P = 0.25] (AS-RED)

M8 x P1.25




Available for spare supplies



Gauge Support Set

Set Model **DGH-3**


Set Contents: Gauge support/Fine adjustment knob/Adapter for ø8 Dial Gauge

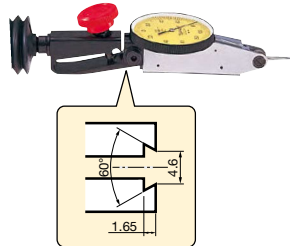

Test indicator mounting groove

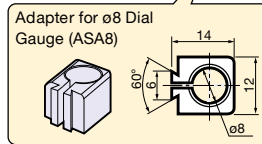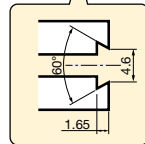


Dial Gauge mounting hole

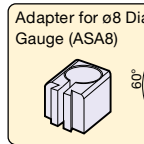

Adapter for ø8 Dial Gauge (ASA8)

Optional Product

- Clamp Piece for ø6
Procure when using a ø6 Dial Gauge.




Model **ASA8-6**

Mini-Mini Type

Fine adjustment knob [P = 0.25] (AS-RED)

M8 x P1.25

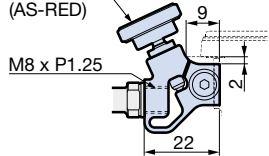


Available for spare supplies


Gauge Support Set

Set Model **DGH-MM**

Set Contents: Gauge support/Fine adjustment knob

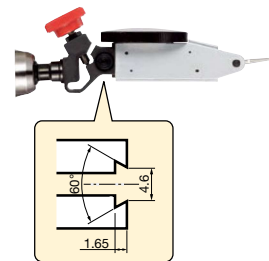


Test indicator mounting groove

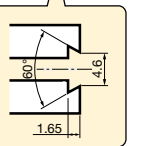


Optional Products

- Adapter for ø8 Dial Gauge

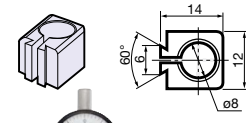

Model **ASA8**

- Clamp Piece for ø6
Procure when using a ø6 Dial Gauge.



Model **ASA8-6**

Flexible arm stand which locks solidly by the special cam mechanism.

Cylindrical Shank Type

- For workpiece centering.

※ Test indicators and dial gauges are not included with any model.

Caution Not suitable for horizontal machines.



Rigid
type

■ **Standard Type**

Model	Shank diameter
ASP-32	ø32
ASP-42	ø42



■ **Mini Type**

Model	Shank diameter
AM-20	ø20
AM-32	ø32



NEW
mini
mini

■ **Mini-Mini Type PAT.**
(Short arm)

Model	Shank diameter
AMM-12	ø12
AMM-20	ø20




NEW
mini
mini


■ **Mini-Mini Type**
(Long arm)

Model	Shank diameter
AML-12	ø12
AML-20	ø20


- AMM-12




- AMM-20



- AML-12




- AML-20




The thread size of the joint between the cylindrical shank and arm is M8 x P1.25 for **AMM**, **AML**, and **AM** and M10 x P1.5 for **ASP**.

Gauge support details **119**


- AM-20

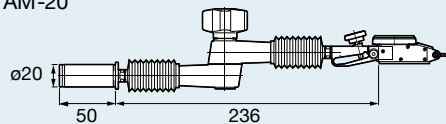


- AM-32

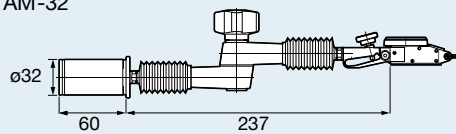

- ASP-32

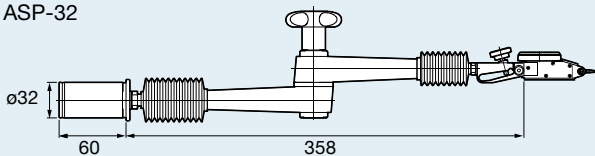

- ASP-42

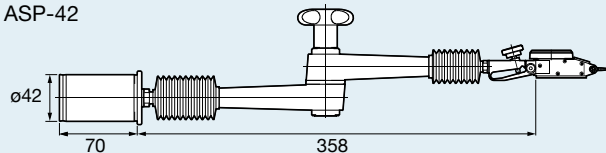

ACCU STAND

HSK Shank Type

- For small machining centers with HSK-E spindles.
- HSK-E Shank type can be directly mounted on spindle.




Mini-Mini Type PAT.


Model	Shank No.
HSK-E25-AMM	HSK-E25
HSK-E32-AMM	-E32

※ Test indicators and dial gauges are not included with any model.

● HSK-E25-AMM



● HSK-E32-AMM




The thread size of the joint between the HSK shank and arm is M8 x P1.25.


Gauge support details **119**

Double Magnetic Base Type

- For workpiece machining and cutting.

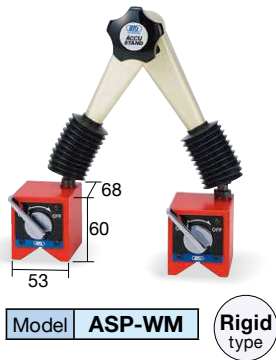

● ASP-WM

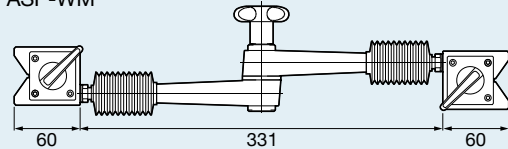

The thread size of the joint between the magnet and arm is M10 x P1.5.

Arm Only Type

- For various applications according to your idea.




■ Standard Type

Model	ASP-A	Rigid type
-------	--------------	-------------------

■ Mini Type

Model	AM-A
-------	-------------

● AM-A

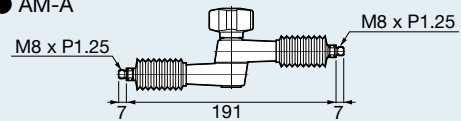

● ASP-A

